

**Work Order ID 94362**

December-10-12 12:40:16 PM

**\*94362\***

Page 1

Item ID: D3391-023

Accept

**\*N900040100\***Setup Start **\*NS1\***

Revision ID:

Stop **\*NS2\***

Item Name: Mid Tube Assembly

Start Date: 10/12/2012 Start Qty: 1.00

**\*1\***

Cust Item ID:

Required Date: 24/12/2012 Req'd Qty: 1.00

**\*1\***

Customer:

Reference:

Approvals:

Process Plan: MLJDate: 12-12-10 Tooling:

Date:

Run Start **\*NR1\***

QC:

Date: SPC (Y/N):

Date:

Stop **\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr

Revision Nbr

D3391

100

0.00

**\*100\***

Skidtubes

Skidtubes

0.00

Skidtubes

**Memo**

1-Cut tube to finish length as per Dwg D3391

2-Drill pilot holes using DT8796 (Do not drill "B" holes) and drill only 1 fwd saddle hole on one side only as per Dwg D3391

3-Open saddles and GHW holes to Ø0.375" except for fwd saddle hole of detail "J"

4-Remove .030" from Fwd indexing Ridge as per Dwg D3391

5-Remove indexing ridge on Fwd &amp; Aft end of skidtube as per Dwg D3391

6-Deburr

7-Drill #30 pilot holes using wearplate Jig DT8217 Identify Ø0.250" holes with paint marker,

\*\*\*DO NOT DRILL HOLES #3-19-20 FROM FWD END OF JIG

8-Open wearplate holes of D3391-023 assembly detail section G-G to Ø0.250" (10 holes) as per Dwg D3391

9-Open wearplate holes of D3391-023 assembly detail section H-H to Ø0.297" (20 holes) as per Dwg D3391

\*\*\*DO NOT OPEN 2 MOST FWD WEARPLATE HOLES\*\*\*

- DC 13/01/22

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____				<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width:100%; border: none;"> <tr> <td style="width:25%;">Skid-tube <input type="checkbox"/></td> <td style="width:25%;">Crosstube <input type="checkbox"/></td> <td style="width:25%;">Water Jet <input type="checkbox"/></td> <td style="width:25%;">Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>						Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>																								
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>																								
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>																								
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																									
<b>Root Cause</b>	<b>Date</b>	<b>Step</b>	<b>Qty</b>	<b>Description of work order update or Non-conformance</b>	<b>Initial Chief Eng</b>	<b>Action Description</b>	<b>Sign &amp; Date</b>	<b>Verification</b>	<b>QC Inspector</b>																		
Doc/Data <input type="checkbox"/>																											
Equip/Tooling <input type="checkbox"/>																											
Operator <input type="checkbox"/>																											
Material <input type="checkbox"/>																											
Setup <input type="checkbox"/>																											
Other <input type="checkbox"/>																											
Process <input type="checkbox"/>																											
Supplier <input type="checkbox"/>																											
Training <input type="checkbox"/>																											
Unapproved <input type="checkbox"/>																											

FAULT CATEGORY			
<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions	<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled  <input type="checkbox"/> Other

**Work Order ID 94362**

December 10-12 12:40:16 PM

**\*94362\***

Page 2

Item ID: D3391-023

Accept

**\*N900040100\***Setup Start **\*NS1\***

Revision ID:

Stop **\*NS2\***

Item Name: Mid Tube Assembly

Start Date: 10/12/2012 Start Qty: 1.00

**\*1\***

Cust Item ID:

Required Date: 24/12/2012 Req'd Qty: 1.00

**\*1\***

Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_  
QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Run Start **\*NR1\***Stop **\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

10-Open .375" holes to .438" \*\*\*do not open fwd saddle holes\*\*\* - De 13/01/22

11-Locate D3391-021 in D3391-023 at 9.00" (see view z-z)

12- Transfer drill one fwd saddle hole only to .188" dia, transfer drill all remaining fwd saddle holes using DT 8149 locating from previously drill .188" dia hole, using t-pins and clicos to ensure perfect allingment, open up previously tranfer drilled pilot holes in D3391-023/-021 to 0.438" dia. in D3391-021

13- Using DT8217, locating from two previously drilled holes, drill remaining wearplate holes into D3391-021.

14- Locating from two fwd wearplate holes in D3391-023 drill remaining 6 wearplte holes in D3391-021 using DT8937

15- Open 12 wearplate holes in D3391-021 to 0.297" dia.

16- insert D3391-021 into D3391-23

17- insert T-pins into first and third fwd saddle holes

18- ON FIRST SIDE ONLY drill out 2nd and forth fwd saddles holes to 0.500" as per

19- ON 2ND SIDE ONLY ream out 2nd and forth saddle hole to 0.499".

20-Deburr and blow out all chips from inside tube, scribe batch # in D3391-023 at aft end.

- De 13/01/23

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____				<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		<b>AGAINST DEPARTMENT/PROCESS</b>  <div style="display: flex; justify-content: space-between;"> <div>           Skid-tube <input type="checkbox"/>            Machining <input type="checkbox"/>            Thermoforming <input type="checkbox"/>            Large Fab <input type="checkbox"/> </div> <div>           Crosstube <input type="checkbox"/>            Small Fab <input type="checkbox"/>            Finishing <input type="checkbox"/>            Composite <input type="checkbox"/> </div> <div>           Water Jet <input type="checkbox"/>            Prod. Eng. Coord. <input type="checkbox"/>            Rec/Store/Packaging <input type="checkbox"/>            Supplier <input type="checkbox"/> </div> <div>           Engineering <input type="checkbox"/>            Quality <input type="checkbox"/>            Other <input type="checkbox"/> </div> </div>					
<b>Root Cause</b>	<b>Date</b>	<b>Step</b>	<b>Qty</b>	<b>Description of work order update or Non-conformance</b>	<b>Initial Chief Eng</b>	<b>Action Description</b>	<b>Sign &amp; Date</b>	<b>Verification</b>	<b>QC Inspector</b>		
Doc/Data <input type="checkbox"/>											
Equip/Tooling <input type="checkbox"/>											
Operator <input type="checkbox"/>											
Material <input type="checkbox"/>											
Setup <input type="checkbox"/>											
Other <input type="checkbox"/>											
Process <input type="checkbox"/>											
Supplier <input type="checkbox"/>											
Training <input type="checkbox"/>											
Unapproved <input type="checkbox"/>											

FAULT CATEGORY									
<b>Landing Gear</b>			<b>General</b>						
<input type="checkbox"/>	Bending	<input type="checkbox"/>	Bend	<input type="checkbox"/>	Grain	<input type="checkbox"/>	Ovalized	<input type="checkbox"/>	Pressure/Forced
<input type="checkbox"/>	Centre Not Concentric to O/S	<input type="checkbox"/>	BOM/Route	<input type="checkbox"/>	Hardware	<input type="checkbox"/>	Over/Under tolerance	<input type="checkbox"/>	Temperature/Cure
<input type="checkbox"/>	Cracks	<input type="checkbox"/>	Broken/Damaged	<input type="checkbox"/>	Inspection Incomplete	<input type="checkbox"/>	Part Incorrect	<input type="checkbox"/>	Weld
<input type="checkbox"/>	Crushed/Crimped	<input type="checkbox"/>	Burrs	<input type="checkbox"/>	Instructions Incomplete/Unclear	<input type="checkbox"/>	Part Lost/Missing	<input type="checkbox"/>	Wrong Stock Pulled
<input type="checkbox"/>	Cuffs	<input type="checkbox"/>	Contamination	<input type="checkbox"/>	Maintenance	<input type="checkbox"/>	Part Moved	<input type="checkbox"/>	Other
<input type="checkbox"/>	Heat Treat	<input type="checkbox"/>	Countersink	<input type="checkbox"/>	Mislabeled	<input type="checkbox"/>	Positioned Wrong		
<input type="checkbox"/>	Inspection Strip in Tube	<input type="checkbox"/>	Cut Too Short	<input type="checkbox"/>	Misread	<input type="checkbox"/>	Power Loss/Surge		
<input type="checkbox"/>	Ripples in Bend	<input type="checkbox"/>	Drill Holes	<input type="checkbox"/>	Offset				
<input type="checkbox"/>	Torque Waves in Extrusion	<input type="checkbox"/>	Drawing	<input type="checkbox"/>	Out of Calibration				
<input type="checkbox"/>	Turning Sequence	<input type="checkbox"/>	Finish	<input type="checkbox"/>	Out of Sequence				
<input type="checkbox"/>	Wave/Twist in Tube	<input type="checkbox"/>	Folio	<input type="checkbox"/>	Outside Dimensions				

# Work Order ID 94362

December-10-12 12:40:16 PM

**\*94362\***

Page 3

Item ID: D3391-023

Accept

**\*N9000040100\***

Setup Start **\*NS1\***

Revision ID:

Stop **\*NS2\***

Item Name: Mid Tube Assembly

Start Date: 10/12/2012 Start Qty: 1.00

**\*1\***

Cust Item ID:

Required Date: 24/12/2012 Req'd Qty: 1.00

**\*1\***

Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Run Start **\*NR1\***

QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Stop **\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
110 <b>*110*</b> QC Quality Control	QC5- Inspect part completeness to step on W/O  Memo	0.00 0.00		<i>OAS</i> <i>13-15</i> <i>13-1-23</i>		<i>J</i>			
120 <b>*120*</b> HandFinish Hand Finishing	Chemical Conversion Coat per QSI005 4.1  Memo	0.00 0.00							<i>- DC 13/01/24</i>
130 <b>*130*</b> QC Quality Control	QC7-Inspect Chemical Conversion Coat  Memo	0.00 0.00							<i>1 Ø CF</i> <i>SAD</i> <i>13-1-24</i>

NCR: Yes / No

## WORK ORDER NON-CONFORMANCE / UPDATE

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data									
Equip/Tooling									
Operator									
Material									
Setup									
Other									
Process									
Supplier									
Training									
Unapproved									

### FAULT CATEGORY

Landing Gear	General	Other
<input type="checkbox"/> Bending	<input type="checkbox"/> Bend	<input type="checkbox"/> Grain
<input type="checkbox"/> Centre Not Concentric to O/S	<input type="checkbox"/> BOM/Route	<input type="checkbox"/> Hardware
<input type="checkbox"/> Cracks	<input type="checkbox"/> Broken/Damaged	<input type="checkbox"/> Inspection Incomplete
<input type="checkbox"/> Crushed/Crimped	<input type="checkbox"/> Burrs	<input type="checkbox"/> Instructions Incomplete/Unclear
<input type="checkbox"/> Cuffs	<input type="checkbox"/> Contamination	<input type="checkbox"/> Maintenance
<input type="checkbox"/> Heat Treat	<input type="checkbox"/> Countersink	<input type="checkbox"/> Mislabeled
<input type="checkbox"/> Inspection Strip in Tube	<input type="checkbox"/> Cut Too Short	<input type="checkbox"/> Misread
<input type="checkbox"/> Ripples in Bend	<input type="checkbox"/> Drill Holes	<input type="checkbox"/> Offset
<input type="checkbox"/> Torque Waves in Extrusion	<input type="checkbox"/> Drawing	<input type="checkbox"/> Out of Calibration
<input type="checkbox"/> Turning Sequence	<input type="checkbox"/> Finish	<input type="checkbox"/> Out of Sequence
<input type="checkbox"/> Wave/Twist in Tube	<input type="checkbox"/> Folio	<input type="checkbox"/> Outside Dimensions
		<input type="checkbox"/> Ovalized
		<input type="checkbox"/> Over/Under tolerance
		<input type="checkbox"/> Part Incorrect
		<input type="checkbox"/> Part Lost/Missing
		<input type="checkbox"/> Part Moved
		<input type="checkbox"/> Positioned Wrong
		<input type="checkbox"/> Power Loss/Surge
		<input type="checkbox"/> Pressure/Forced
		<input type="checkbox"/> Temperature/Cure
		<input type="checkbox"/> Weld
		<input type="checkbox"/> Wrong Stock Pulled
		<input type="checkbox"/> Other

# Work Order ID - 94362

December-10-12 12:40:16 PM

**\*94362\***

Page 4

Item ID: D3391-023

Accept

**\*N900040100\***

Setup Start **\*NS1\***

Revision ID:

Stop **\*NS2\***

Item Name: Mid Tube Assembly

Start Date: 10/12/2012 Start Qty: 1.00

**\*1\***

Cust Item ID:

Required Date: 24/12/2012 Req'd Qty: 1.00

**\*1\***

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start **\*NR1\***

QC:

Date:

SPC (Y/N):

Date:

Stop **\*NR2\***

Sequence ID/  
Work Center ID

Operation  
Description

Set Up/  
Run Hours

Tool ID

Tool #

Plan  
Code

Accept  
Qty

Reject  
Qty

Reject  
Number

Insp.  
Stamp

140

0.00

**\*140\***

Skidtubes

Skidtubes

**Memo**

0.00

1-Open float bag holes as per dwg  
2-C'sink float bag holes as per dwg  
3- Prepare tube for welding  
4-Bond web in place as per Dwg D3391 & QSI 015.  
Adhere for 12 hours)  
A/R Sikaflex exp: 13/06/22  
batch#: 123944  
NOTE:ENSURE WEB IS INSERTED IN AFT END OF TUBE

- Dec 13/01/24

150

QC5- Inspect part completeness to step on W/O

0.00

**\*150\***

QC

**Memo**

0.00

Quality Control

1 0 13-01-25 (DAS 18 9-83)

NCR: Yes / No

## WORK ORDER NON-CONFORMANCE / UPDATE

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____				<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width:100%; border: none;"> <tr> <td style="width:15%;">Skid-tube <input type="checkbox"/></td> <td style="width:15%;">Crosstube <input type="checkbox"/></td> <td style="width:15%;">Water Jet <input type="checkbox"/></td> <td style="width:15%;">Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>						Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>																								
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>																								
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>																								
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																									
Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector																		
Doc/Data <input type="checkbox"/>																											
Equip/Tooling <input type="checkbox"/>																											
Operator <input type="checkbox"/>																											
Material <input type="checkbox"/>																											
Setup <input type="checkbox"/>																											
Other <input type="checkbox"/>																											
Process <input type="checkbox"/>																											
Supplier <input type="checkbox"/>																											
Training <input type="checkbox"/>																											
Unapproved <input type="checkbox"/>																											
<b>FAULT CATEGORY</b>																											
<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube			<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio			<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions			<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge		<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled  <input type="checkbox"/> Other																



# Work Order ID 94362

December-10-12 12:40:16 PM

**\*94362\***

Page 5

Item ID: D3391-023

Accept

**\*N900040100\***

Setup Start **\*NS1\***

Revision ID:

Stop **\*NS2\***

Item Name: Mid Tube Assembly

Start Date: 10/12/2012 Start Qty: 1.00

**\*1\***

Cust Item ID:

Required Date: 24/12/2012 Req'd Qty: 1.00

**\*1\***

Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_  
QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Run Start **\*NR1\***

Stop **\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

160

0.00

**\*160\***

Skidtubes

Skidtubes

Memo

0.00

Skidtubes

1-Weld crossbolt spacer as per dwg D3391 & QSI 004  
2-grind weld flush

*AK M122324 BE 13-01-25*

*- DC 13/01/25*

170

QC10- Inspect visual per QSI004- ground welds ✓ 0.00

**\*170\***

QC

Memo

0.00

Quality Control

*13-01-29*

*DAS 09 8-89*

180

QC5- Inspect part completeness to step on W/O 0.00

**\*180\***

QC

Memo

0.00

Quality Control

*DAS 15 2-89*

*13-01-28*

*J*

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____				<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		<b>AGAINST DEPARTMENT/PROCESS</b>  <div style="display: flex; justify-content: space-between;"> <div>           Skid-tube <input type="checkbox"/>            Machining <input type="checkbox"/>            Thermoforming <input type="checkbox"/>            Large Fab <input type="checkbox"/> </div> <div>           Crosstube <input type="checkbox"/>            Small Fab <input type="checkbox"/>            Finishing <input type="checkbox"/>            Composite <input type="checkbox"/> </div> <div>           Water Jet <input type="checkbox"/>            Prod. Eng. Coord. <input type="checkbox"/>            Rec/Store/Packaging <input type="checkbox"/>            Supplier <input type="checkbox"/> </div> <div>           Engineering <input type="checkbox"/>            Quality <input type="checkbox"/>            Other <input type="checkbox"/> </div> </div>					
<b>Root Cause</b>	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Doc/Data <input type="checkbox"/>											
Equip/Tooling <input type="checkbox"/>											
Operator <input type="checkbox"/>											
Material <input type="checkbox"/>											
Setup <input type="checkbox"/>											
Other <input type="checkbox"/>											
Process <input type="checkbox"/>											
Supplier <input type="checkbox"/>											
Training <input type="checkbox"/>											
Unapproved <input type="checkbox"/>											
<b>FAULT CATEGORY</b>											
<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube			<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio			<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions			<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge		<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled  <input type="checkbox"/> Other

# Work Order ID 94362

December-10-12 12:40:16 PM

**\*94362\***

Page 6

Item ID: D3391-023

Accept

**\*N900040100\***

Setup Start **\*NS1\***

Revision ID:

Stop **\*NS2\***

Item Name: Mid Tube Assembly

Start Date: 10/12/2012 Start Qty: 1.00

**\*1\***

Cust Item ID:

Required Date: 24/12/2012 Req'd Qty: 1.00

**\*1\***

Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_  
QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Run Start **\*NR1\***  
Stop **\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
185	Pressure Wash per QSI005 4.3	0.00							
<b>*185*</b>									
HandFinish	Memo	0.00							
Hand Finishing	AND REALODINE AS PER PAR09-043								
190	White Gloss(Ref:4.3.5.1) per QSI005 4.3 Alum	0.00							
<b>*190*</b>									
Powdercoat	Memo	0.00							
Powder Coating	START TIME: 10:30 OVEN TEMPERATURE: 320° FINISH TIME: 11:00								
200	QC3- Inspect Part Finish	0.00							
<b>*200*</b>									
QC	Memo	0.00							
Quality Control									

1 16 13130

1 16 13-3-5

1x 1 13/04/29

NCR: Yes / No

## WORK ORDER NON-CONFORMANCE / UPDATE

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____				<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width: 100%; border: none;"> <tr> <td style="width: 25%;">Skid-tube <input type="checkbox"/></td> <td style="width: 25%;">Crosstube <input type="checkbox"/></td> <td style="width: 25%;">Water Jet <input type="checkbox"/></td> <td style="width: 25%;">Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>						Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>																								
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>																								
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>																								
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																									
<b>Root Cause</b>	<b>Date</b>	<b>Step</b>	<b>Qty</b>	<b>Description of work order update or Non-conformance</b>	<b>Initial Chief Eng</b>	<b>Action Description</b>	<b>Sign &amp; Date</b>	<b>Verification</b>	<b>QC Inspector</b>																		
Doc/Data <input type="checkbox"/>																											
Equip/Tooling <input type="checkbox"/>																											
Operator <input type="checkbox"/>																											
Material <input type="checkbox"/>																											
Setup <input type="checkbox"/>																											
Other <input type="checkbox"/>																											
Process <input type="checkbox"/>																											
Supplier <input type="checkbox"/>																											
Training <input type="checkbox"/>																											
Unapproved <input type="checkbox"/>																											
<b>FAULT CATEGORY</b>																											
<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube			<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio			<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions			<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled  <input type="checkbox"/> Other																		

# Work Order ID 94362

December-10-12 12:40:16 PM

**\*94362\***

Page 7

Item ID: D3391-023

Accept

**\*N900040100\***

Setup Start **\*NS1\***

Revision ID:

Stop **\*NS2\***

Item Name: Mid Tube Assembly

Start Date: 10/12/2012 Start Qty: 1.00

**\*1\***

Cust Item ID:

Required Date: 24/12/2012 Req'd Qty: 1.00

**\*1\***

Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_  
QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Run Start **\*NR1\***

Stop **\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
230		0.00							
<b>*230*</b>	HandFinishing								
HandFinish	Memo	0.00							
Hand Finishing	1- press fit D3591-1 spacers using DT9416 starting from 0.500" side								
	2-Install Inserts as per Dwg.								
240		0.00							
<b>*240*</b>	QC5- Inspect part completeness to step on W/O	0.00							
QC	Memo	0.00							
Quality Control									
250		0.00							
<b>*250*</b>	Identify as per dwg & Stock Location: <u>w/o</u>	0.00							
Packaging	Memo	0.00							
Packaging									

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width: 100%; border: none;"> <tr> <td style="width: 25%;">Skid-tube <input type="checkbox"/></td> <td style="width: 25%;">Crosstube <input type="checkbox"/></td> <td style="width: 25%;">Water Jet <input type="checkbox"/></td> <td style="width: 25%;">Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data									
Equip/Tooling									
Operator									
Material									
Setup									
Other									
Process									
Supplier									
Training									
Unapproved									

**FAULT CATEGORY**

Landing Gear	General	Other
<input type="checkbox"/> Bending	<input type="checkbox"/> Bend	<input type="checkbox"/> Grain
<input type="checkbox"/> Centre Not Concentric to O/S	<input type="checkbox"/> BOM/Route	<input type="checkbox"/> Hardware
<input type="checkbox"/> Cracks	<input type="checkbox"/> Broken/Damaged	<input type="checkbox"/> Inspection Incomplete
<input type="checkbox"/> Crushed/Crimped	<input type="checkbox"/> Burrs	<input type="checkbox"/> Instructions Incomplete/Unclear
<input type="checkbox"/> Cuffs	<input type="checkbox"/> Contamination	<input type="checkbox"/> Maintenance
<input type="checkbox"/> Heat Treat	<input type="checkbox"/> Countersink	<input type="checkbox"/> Mislabeled
<input type="checkbox"/> Inspection Strip in Tube	<input type="checkbox"/> Cut Too Short	<input type="checkbox"/> Misread
<input type="checkbox"/> Ripples in Bend	<input type="checkbox"/> Drill Holes	<input type="checkbox"/> Offset
<input type="checkbox"/> Torque Waves in Extrusion	<input type="checkbox"/> Drawing	<input type="checkbox"/> Out of Calibration
<input type="checkbox"/> Turning Sequence	<input type="checkbox"/> Finish	<input type="checkbox"/> Out of Sequence
<input type="checkbox"/> Wave/Twist in Tube	<input type="checkbox"/> Folio	<input type="checkbox"/> Outside Dimensions
		<input type="checkbox"/> Ovalized
		<input type="checkbox"/> Over/Under tolerance
		<input type="checkbox"/> Part Incorrect
		<input type="checkbox"/> Part Lost/Missing
		<input type="checkbox"/> Part Moved
		<input type="checkbox"/> Positioned Wrong
		<input type="checkbox"/> Power Loss/Surge
		<input type="checkbox"/> Pressure/Forced
		<input type="checkbox"/> Temperature/Cure
		<input type="checkbox"/> Weld
		<input type="checkbox"/> Wrong Stock Pulled
		<input type="checkbox"/> Other

**Work Order ID 94362**

December-10-12 12:40:16 PM

**\*94362\***

Page 8

Item ID: D3391-023

Accept

**\*N900040100\***Setup Start **\*NS1\***

Revision ID:

Stop **\*NS2\***

Item Name: Mid Tube Assembly

Start Date: 10/12/2012 Start Qty: 1.00

**\*1\***

Cust Item ID:

Required Date: 24/12/2012 Req'd Qty: 1.00

**\*1\***


Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_  
QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Run Start **\*NR1\***Stop **\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
260	QC21- Final Inspection - Work Order Release	0.00							
<b>*260*</b>									
QC	Memo	0.00							
Quality Control									

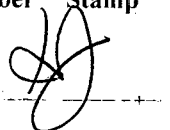13/5/10 

11/13-059

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____				<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		<b>AGAINST DEPARTMENT/PROCESS</b>  <div style="display: flex; justify-content: space-between;"> <div>           Skid-tube <input type="checkbox"/>            Machining <input type="checkbox"/>            Thermoforming <input type="checkbox"/>            Large Fab <input type="checkbox"/> </div> <div>           Crosstube <input type="checkbox"/>            Small Fab <input type="checkbox"/>            Finishing <input type="checkbox"/>            Composite <input type="checkbox"/> </div> <div>           Water Jet <input type="checkbox"/>            Prod. Eng. Coord. <input type="checkbox"/>            Rec/Store/Packaging <input type="checkbox"/>            Supplier <input type="checkbox"/> </div> <div>           Engineering <input type="checkbox"/>            Quality <input type="checkbox"/>            Other <input type="checkbox"/> </div> </div>					
<b>Root Cause</b>	<b>Date</b>	<b>Step</b>	<b>Qty</b>	<b>Description of work order update or Non-conformance</b>	<b>Initial Chief Eng</b>	<b>Action Description</b>	<b>Sign &amp; Date</b>	<b>Verification</b>	<b>QC Inspector</b>		
Doc/Data <input type="checkbox"/>											
Equip/Tooling <input type="checkbox"/>											
Operator <input type="checkbox"/>											
Material <input type="checkbox"/>											
Setup <input type="checkbox"/>											
Other <input type="checkbox"/>											
Process <input type="checkbox"/>											
Supplier <input type="checkbox"/>											
Training <input type="checkbox"/>											
Unapproved <input type="checkbox"/>											

FAULT CATEGORY										
<b>Landing Gear</b>			<b>General</b>							
<input type="checkbox"/> Bending	<input type="checkbox"/> Centre Not Concentric to O/S	<input type="checkbox"/> Cracks	<input type="checkbox"/> Crushed/Crimped	<input type="checkbox"/> Cuffs	<input type="checkbox"/> Heat Treat	<input type="checkbox"/> Inspection Strip in Tube	<input type="checkbox"/> Ripples in Bend	<input type="checkbox"/> Torque Waves in Extrusion	<input type="checkbox"/> Turning Sequence	<input type="checkbox"/> Wave/Twist in Tube
<input type="checkbox"/> Bend	<input type="checkbox"/> BOM/Route	<input type="checkbox"/> Broken/Damaged	<input type="checkbox"/> Burrs	<input type="checkbox"/> Contamination	<input type="checkbox"/> Countersink	<input type="checkbox"/> Cut Too Short	<input type="checkbox"/> Drill Holes	<input type="checkbox"/> Drawing	<input type="checkbox"/> Finish	<input type="checkbox"/> Folio
<input type="checkbox"/> Grain	<input type="checkbox"/> Hardware	<input type="checkbox"/> Inspection Incomplete	<input type="checkbox"/> Instructions Incomplete/Unclear	<input type="checkbox"/> Maintenance	<input type="checkbox"/> Mislabeled	<input type="checkbox"/> Misread	<input type="checkbox"/> Offset	<input type="checkbox"/> Out of Calibration	<input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions
<input type="checkbox"/> Ovalized	<input type="checkbox"/> Over/Under tolerance	<input type="checkbox"/> Part Incorrect	<input type="checkbox"/> Part Lost/Missing	<input type="checkbox"/> Part Moved	<input type="checkbox"/> Positioned Wrong	<input type="checkbox"/> Power Loss/Surge	<input type="checkbox"/> Pressure/Forced	<input type="checkbox"/> Temperature/Cure	<input type="checkbox"/> Weld	<input type="checkbox"/> Wrong Stock Pulled
										<input type="checkbox"/> Other



December-10-12 12:40:20 PM

Page 1

\*94362\*

\*D3391-023\*

**Start Date:** 10/12/2012

**Required Date:** 24/12/2012

**Start Qty: 1.00**

**Required Qty: 1.00**

Comments:	IPP A05.10.20	New Issue	KJ/EC	
	IPP B06.02.10	ECN773 dwg rev.D	EC	
	IPP C	07.03.20 rev F dwg		EC
	IPP D	07.03.28 re-format		EC
	IPP E	07.10.31 ecn 1053P		EC
	IPP Rev:F	ECN 1056 07-11-13 DD	verified by:	EC
	IPP Rev:G	08-09-08 new process (ecn 08-510)	DD	verified by:EC
	IPP Rev:H	08-09-10 revH as per dwg	DD	verified by:EC
	IPP Rev:I	08-11-13 Removed steps per w/o, QC	KJ verified by:	ec IPP
	Rev:J	add in seq 140 expire date &# sikaflex	DD 10.02.17	verified by:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D2500-1-100		Manufactured	No			100	Each	152.0000	1	1			
<b>*D2500-1-100*</b> Skidtube Extrusion													
				<u>Location</u>		<u>Loc Qty</u>		<u>Loc Code</u>					
				HALL		152							
				50251		3							
				82373		57							
				86065		92							
D3391-021		Manufactured	No			100	Each	0.0000	1	1			
<b>*D3391-021*</b> Fwd Tube Assembly													
D3389-1		Manufactured	No			140	Each	1.0000	1	1			
<b>*D3389-1*</b> Web													
				<u>Location</u>		<u>Loc Qty</u>		<u>Loc Code</u>					
				LG		1							
				85508		1							

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____				<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width: 100%; border: none;"> <tr> <td style="width: 25%;">Skid-tube <input type="checkbox"/></td> <td style="width: 25%;">Crosstube <input type="checkbox"/></td> <td style="width: 25%;">Water Jet <input type="checkbox"/></td> <td style="width: 25%;">Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>						Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>																								
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>																								
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>																								
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																									
<b>Root Cause</b>	<b>Date</b>	<b>Step</b>	<b>Qty</b>	<b>Description of work order update or Non-conformance</b>	<b>Initial Chief Eng</b>	<b>Action Description</b>	<b>Sign &amp; Date</b>	<b>Verification</b>	<b>QC Inspector</b>																		
Doc/Data <input type="checkbox"/>																											
Equip/Tooling <input type="checkbox"/>																											
Operator <input type="checkbox"/>																											
Material <input type="checkbox"/>																											
Setup <input type="checkbox"/>																											
Other <input type="checkbox"/>																											
Process <input type="checkbox"/>																											
Supplier <input type="checkbox"/>																											
Training <input type="checkbox"/>																											
Unapproved <input type="checkbox"/>																											

FAULT CATEGORY			
<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions	<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled  <input type="checkbox"/> Other

# Picklist Print

December-10-12 12:40:20 PM

Page 2

Work Order ID: 94362

\*94362\*

Parent Item: D3391-023

\*D3391-023\*

Parent Item Name: Mid Tube Assembly

Start Date: 10/12/2012

Required Date: 24/12/2012

Start Qty: 1.00

Required Qty: 1.00

D3681-1

Manufactured No

160

Each

118.0000

5

5

\*D3681-1\*

Spacer

\*\*

BE 13-01-25  
B93371 x5

## Location

## Loc Qty

## Loc Code

LG001

10

68958

2

69893

2

71845

2

74874

1

76004

1

77501

2

LG005

108

80361

1

87611

2

92727

105

Each

64.0000

2

\*\*

11 12/05/08

D3591-1

Manufactured No

\*D3591-1\*

Bushing

## Location

## Loc Qty

## Loc Code

FP001

5

11100699

12

80377

4

82027

1

FP002

31

57350

1

92873

30

GA

28

83237

28

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data									
Equip/Tooling									
Operator									
Material									
Setup									
Other									
Process									
Supplier									
Training									
Unapproved									

**FAULT CATEGORY**

Landing Gear	General	Other
<input type="checkbox"/> Bending	<input type="checkbox"/> Bend	<input type="checkbox"/> Grain
<input type="checkbox"/> Centre Not Concentric to O/S	<input type="checkbox"/> BOM/Route	<input type="checkbox"/> Hardware
<input type="checkbox"/> Cracks	<input type="checkbox"/> Broken/Damaged	<input type="checkbox"/> Inspection Incomplete
<input type="checkbox"/> Crushed/Crimped	<input type="checkbox"/> Burrs	<input type="checkbox"/> Instructions Incomplete/Unclear
<input type="checkbox"/> Cuffs	<input type="checkbox"/> Contamination	<input type="checkbox"/> Maintenance
<input type="checkbox"/> Heat Treat	<input type="checkbox"/> Countersink	<input type="checkbox"/> Mislabeled
<input type="checkbox"/> Inspection Strip in Tube	<input type="checkbox"/> Cut Too Short	<input type="checkbox"/> Misread
<input type="checkbox"/> Ripples in Bend	<input type="checkbox"/> Drill Holes	<input type="checkbox"/> Offset
<input type="checkbox"/> Torque Waves in Extrusion	<input type="checkbox"/> Drawing	<input type="checkbox"/> Out of Calibration
<input type="checkbox"/> Turning Sequence	<input type="checkbox"/> Finish	<input type="checkbox"/> Out of Sequence
<input type="checkbox"/> Wave/Twist in Tube	<input type="checkbox"/> Folio	<input type="checkbox"/> Outside Dimensions
		<input type="checkbox"/> Ovalized
		<input type="checkbox"/> Over/Under tolerance
		<input type="checkbox"/> Part Incorrect
		<input type="checkbox"/> Part Lost/Missing
		<input type="checkbox"/> Part Moved
		<input type="checkbox"/> Positioned Wrong
		<input type="checkbox"/> Power Loss/Surge
		<input type="checkbox"/> Pressure/Forced
		<input type="checkbox"/> Temperature/Cure
		<input type="checkbox"/> Weld
		<input type="checkbox"/> Wrong Stock Pulled
		<input type="checkbox"/> Other

# Picklist Print

December-10-12 12:40:20 PM

Page 3

Work Order ID: 94362

Parent Item: D3391-023

Parent Item Name: Mid Tube Assembly

\*94362\*

\*D3391-023\*

Start Date: 10/12/2012

Required Date: 24/12/2012

Start Qty: 1.00

Required Qty: 1.00

ALS4-1032-130

Purchased

No

230

Each

389.0000

20

20

\*AI S4-1032-130\*

\*\*

ll

13/04/30

Insert

## Location

## Loc Qty

## Loc Code

FP001

389

11124163

x20

119084

116

120671

89

120807

36

120837

8

121269

140


NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____				<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		<b>AGAINST DEPARTMENT/PROCESS</b>  <div style="display: flex; justify-content: space-between;"> <div>           Skid-tube <input type="checkbox"/>            Machining <input type="checkbox"/>            Thermoforming <input type="checkbox"/>            Large Fab <input type="checkbox"/> </div> <div>           Crosstube <input type="checkbox"/>            Small Fab <input type="checkbox"/>            Finishing <input type="checkbox"/>            Composite <input type="checkbox"/> </div> <div>           Water Jet <input type="checkbox"/>            Prod. Eng. Coord. <input type="checkbox"/>            Rec/Store/Packaging <input type="checkbox"/>            Supplier <input type="checkbox"/> </div> <div>           Engineering <input type="checkbox"/>            Quality <input type="checkbox"/>            Other <input type="checkbox"/> </div> </div>					
<b>Root Cause</b>	<b>Date</b>	<b>Step</b>	<b>Qty</b>	<b>Description of work order update or Non-conformance</b>	<b>Initial Chief Eng</b>	<b>Action Description</b>	<b>Sign &amp; Date</b>	<b>Verification</b>	<b>QC Inspector</b>		
Doc/Data <input type="checkbox"/>											
Equip/Tooling <input type="checkbox"/>											
Operator <input type="checkbox"/>											
Material <input type="checkbox"/>											
Setup <input type="checkbox"/>											
Other <input type="checkbox"/>											
Process <input type="checkbox"/>											
Supplier <input type="checkbox"/>											
Training <input type="checkbox"/>											
Unapproved <input type="checkbox"/>											
<b>FAULT CATEGORY</b>											
<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube			<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio			<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions			<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge		<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled  <input type="checkbox"/> Other

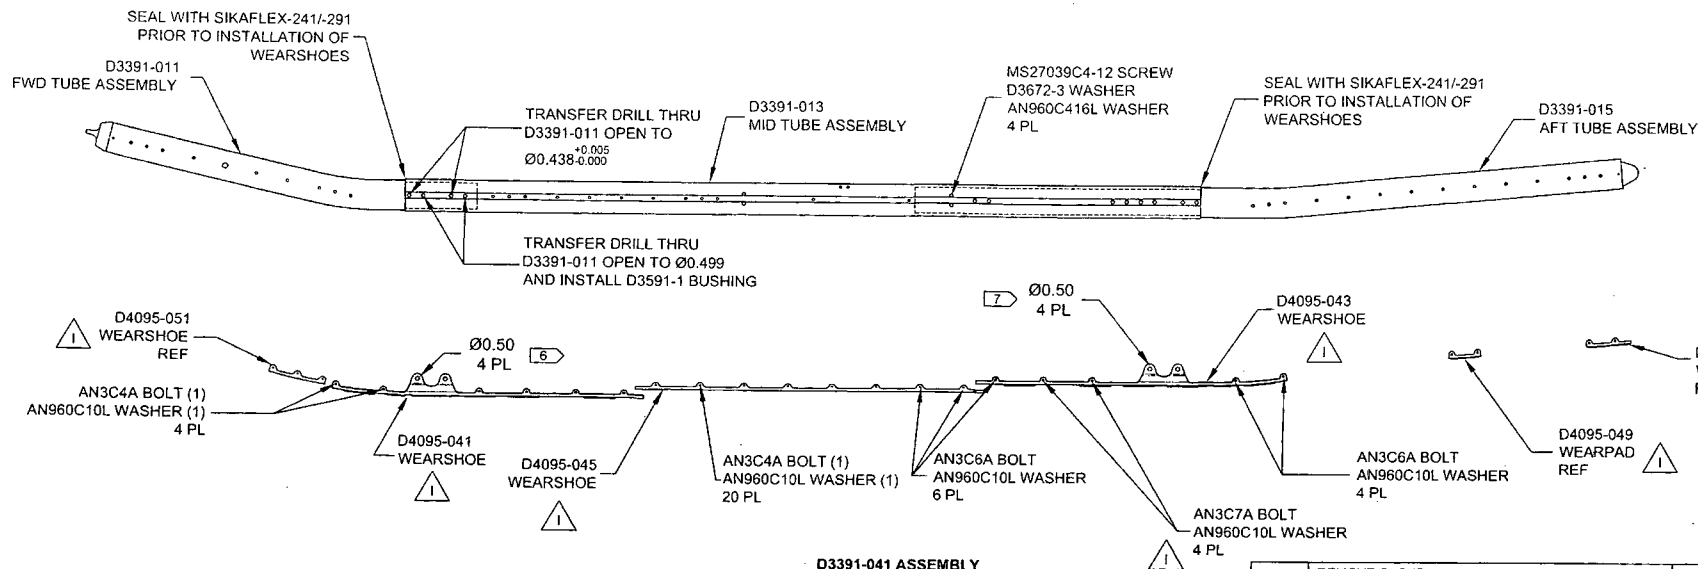

**D3391-041 FLOAT SKIDTUBE ASSEMBLY PARTS LIST**

QTY	PART NUMBER	DESCRIPTION
X	D3391-041	FLOAT SKIDTUBE ASSEMBLY
1	D3391-011	FWD TUBE ASSEMBLY
1	D3391-013	MID TUBE ASSEMBLY
1	D3391-015	AFT TUBE ASSEMBLY
2	D3591-1	BUSHING
4	D3672-3	WASHER
1	D4095-041	WEARSHOE
1	D4095-043	WEARSHOE
1	D4095-045	WEARSHOE
1	D4095-047	WEARSHOE
1	D4095-049	WEARPAD
1	D4095-051	WEARSHOE
24	AN3C4A	BOLT
10	AN3C6A	BOLT
4	AN3C7A	BOLT
38	AN960C10L	WASHER
4	MS27039C4-12	SCREW
4	AN960C416L	WASHER


**GENERAL NOTES**

- 1). FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1 POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 2). COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.
- 3). TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4). UNITS: INCHES UNLESS OTHERWISE NOTED
- 5). USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 SIZE HOLES FOR WEARSHOE INSERTS. C'BORE AS NOTED AND INSTALL INSERTS EXCEPT WHERE INDICATED.
- 6). FIT D4095-041 TO SKIDTUBE WITH D2571 AND D2572 SADDLES INSTALLED WITH APPROPRIATE HARDWARE AND SPACERS IN FORWARD AND AFT HOLES AND TRANSFER DRILL Ø0.50 HOLES FROM SADDLE TO D4095-041
- 7). FIT D4095-043 TO SKIDTUBE WITH D2571 AND D2572 SADDLES INSTALLED WITH THE APPROPRIATE HARDWARE AND SPACERS IN FORWARD AND AFT HOLES AND TRANSFER DRILL Ø0.50 HOLES FROM SADDLE TO D4095-043

REV.	DESCRIPTION	BY	DATE
I	REMOVE GASKETS AND REPLACE ALL WEARSHOES; PARTS LIST UPDATE, ZN A8-1, ZN A8-2, ZN A6-4, ZN B6-8; LPS-3 COATING REMOVED FROM NOTE 2, ZN A3-1, ZN A3-2, REMOVED INSERT AELS-1032-130, ZN B6-4, B2-4, C7-8, C3-8; REMOVED HOLES, ZN D6-4 ZN D2-4, ZN D7-8, ZN D3-8	XDF	11.10.13
H	DRAWING UPDATED TO CURRENT STANDARDS. SHT 1 PL ADDED D3591-1 BUSHING, ZN C6 Ø0.438 DIM WAS 4 PL. ADDED Ø0.499 DIM AND D3591-1 BUSHING. SHT 2 PL ADDED D3591-1 BUSHING, ZN C6 Ø0.438 DIM WAS 4 PL. ADDED Ø0.499 DIM AND D3591-1 BUSHING. (FOR FURTHER INFO SEE DSI 9364 & NCR 08-074)	AJS	08.08.20
G	REPLACE NAS INSERTS W/ AELS INSERTS SWITCH TO D3670-XXXX SPACERS FOR INSTALLING FLOAT BAGS, DWG REORGANIZED FOR CLARITY	DC	07.07.31
F	ADD SS WEARSHOE, GASKET REMOVE FWD SADDLE HOLE -011/-021	PH	07.01.18
E	CHANGE TOLERANCE, EASE MANUFACTURE	PH	06.04.25
D	UPDATE TOLERANCE, CHANGE HOLE SIZE	PH	06.01.23
C	LENGTHEN AFT EXTENSION	PH	05.09.27
B	DRAWING UPDATES	PH	05.06.10
A	NEW ISSUE	PH	05.02.07
DESIGN	PH	<b>DART AEROSPACE USA, INC</b> KENT, WA	
DRAWN	XDF		
CHECKED		DRAWING NO.	REV. I
MFG. APPR.		D3391	SHEET 1 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR TRANSMITTED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

STATION  
ENGINEERING  
UNCONTROLLED  
SUBJECT  
WITHOUT  
WORK ORDER  
NO 94362 MW  
12-12-10

94362

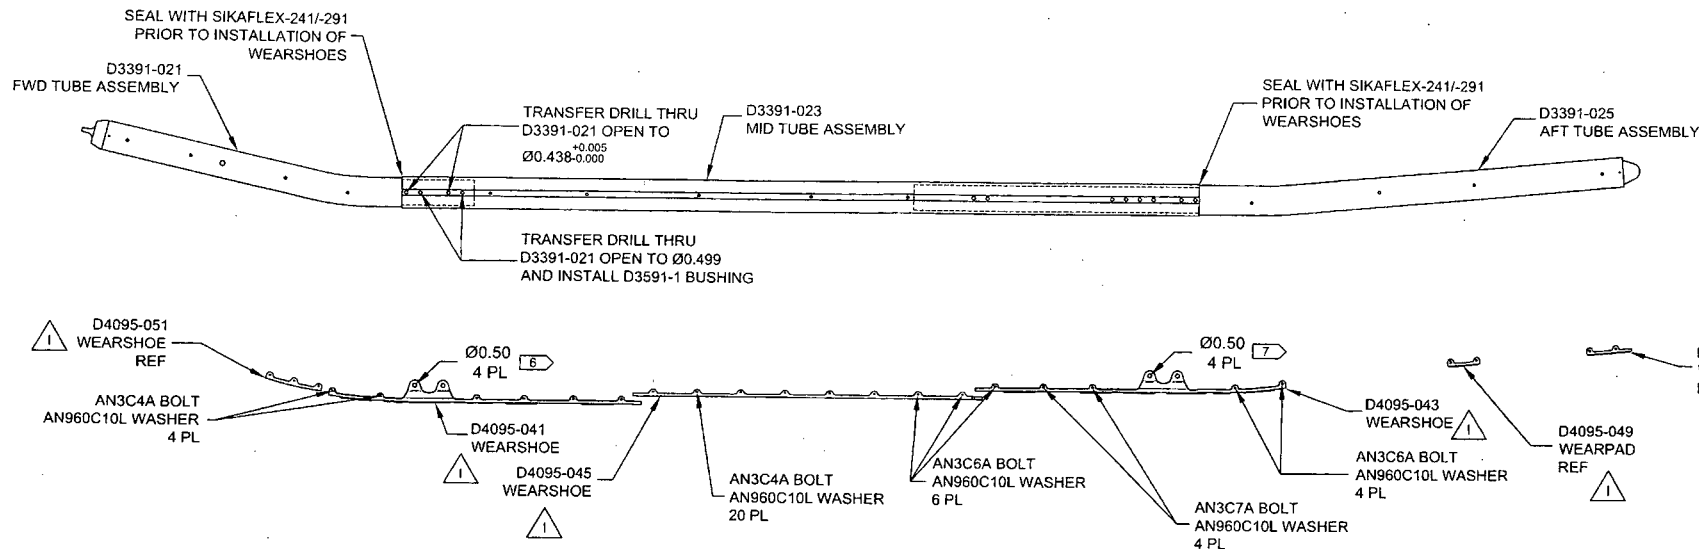

**D3391-043 ASSEMBLY**

**D3391-043 FLOAT SKIDTUBE ASSEMBLY PARTS LIST**

QTY	PART NUMBER	DESCRIPTION
X	D3391-043	FLOAT SKIDTUBE ASSEMBLY
1	D3391-021	FWD TUBE ASSEMBLY
1	D3391-023	MID TUBE ASSEMBLY
1	D3391-025	AFT TUBE ASSEMBLY
2	D3591-1	BUSHING
1	D4095-041	WEARSHOE
1	D4095-043	WEARSHOE
1	D4095-045	WEARSHOE
1	D4095-047	WEARPAD
1	D4095-049	WEARPAD
1	D4095-051	WEARSHOE
24	AN3C4A	BOLT
10	AN3C6A	BOLT
4	AN3C7A	BOLT
38	AN960C10L	WASHER

**GENERAL NOTES**

- 1) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 2) COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON"
- 3) AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.
- 4) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 5) UNITS: INCHES UNLESS OTHERWISE NOTED
- 6) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 SIZE HOLES FOR WEARSHOE INSERTS. C'BORE AS NOTED AND INSTALL INSERTS EXCEPT WHERE INDICATED.
- 7) FIT D4095-041 TO SKIDTUBE WITH D2571 AND D2572 SADDLES INSTALLED WITH APPROPRIATE HARDWARE AND SPACERS IN FORWARD AND AFT HOLES AND TRANSFER DRILL Ø0.50 HOLES FROM SADDLE TO D4095-041
- 8) FIT D4095-043 TO SKIDTUBE WITH D2571 AND D2572 SADDLES INSTALLED WITH THE APPROPRIATE HARDWARE AND SPACERS IN FORWARD AND AFT HOLES AND TRANSFER DRILL Ø0.50 HOLES FROM SADDLE TO D4095-043


RELEASED  
2011-11-04

DESIGN	PH	<b>DART AEROSPACE USA, INC.</b>	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO.	REV. 1
MFG. APPR.		D3391	SHEET 2 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC.	


THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.




94362

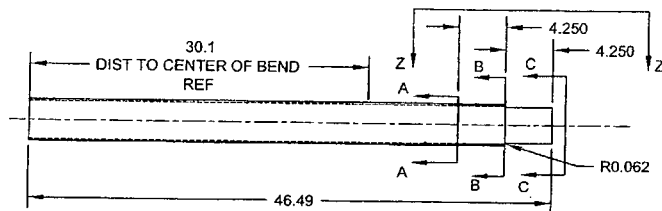


**D3391-1 CUTTING DETAIL**  
(MAKE FROM D6013-047 SKIDTUBE MATERIAL)

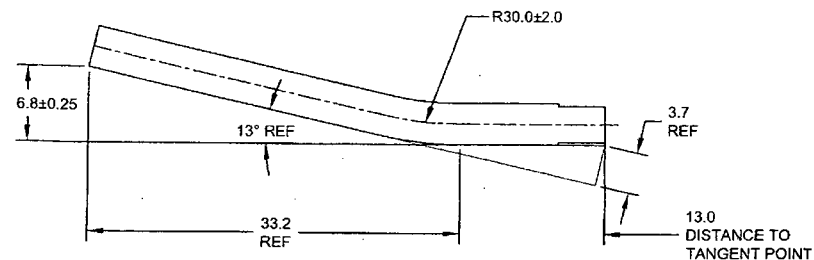


**D3391-011/-021 BENDING DETAIL**  
(MAKE FROM D3391-1)

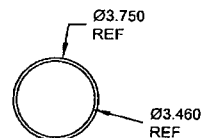


**SECTION A-A**  
SCALE 2X

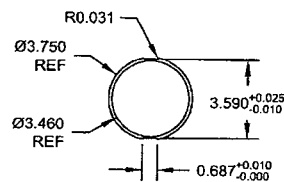

**SECTION B-B**  
SCALE 2X

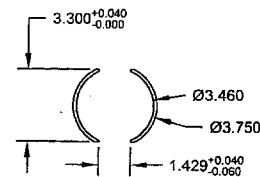

**SECTION C-C**  
SCALE 2X

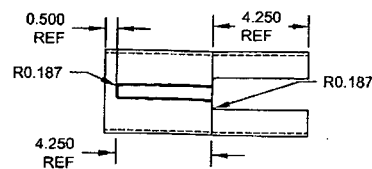


**VIEW Z-Z**  
SCALE 2X

RELEASED  
2011-11-04

DESIGN	PH	<b>DART AEROSPACE USA, INC</b>	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO.	REV. 1
MFG. APPR.		D3391	SHEET 3 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	COPYRIGHT © 2003 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMERCE TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	


94362

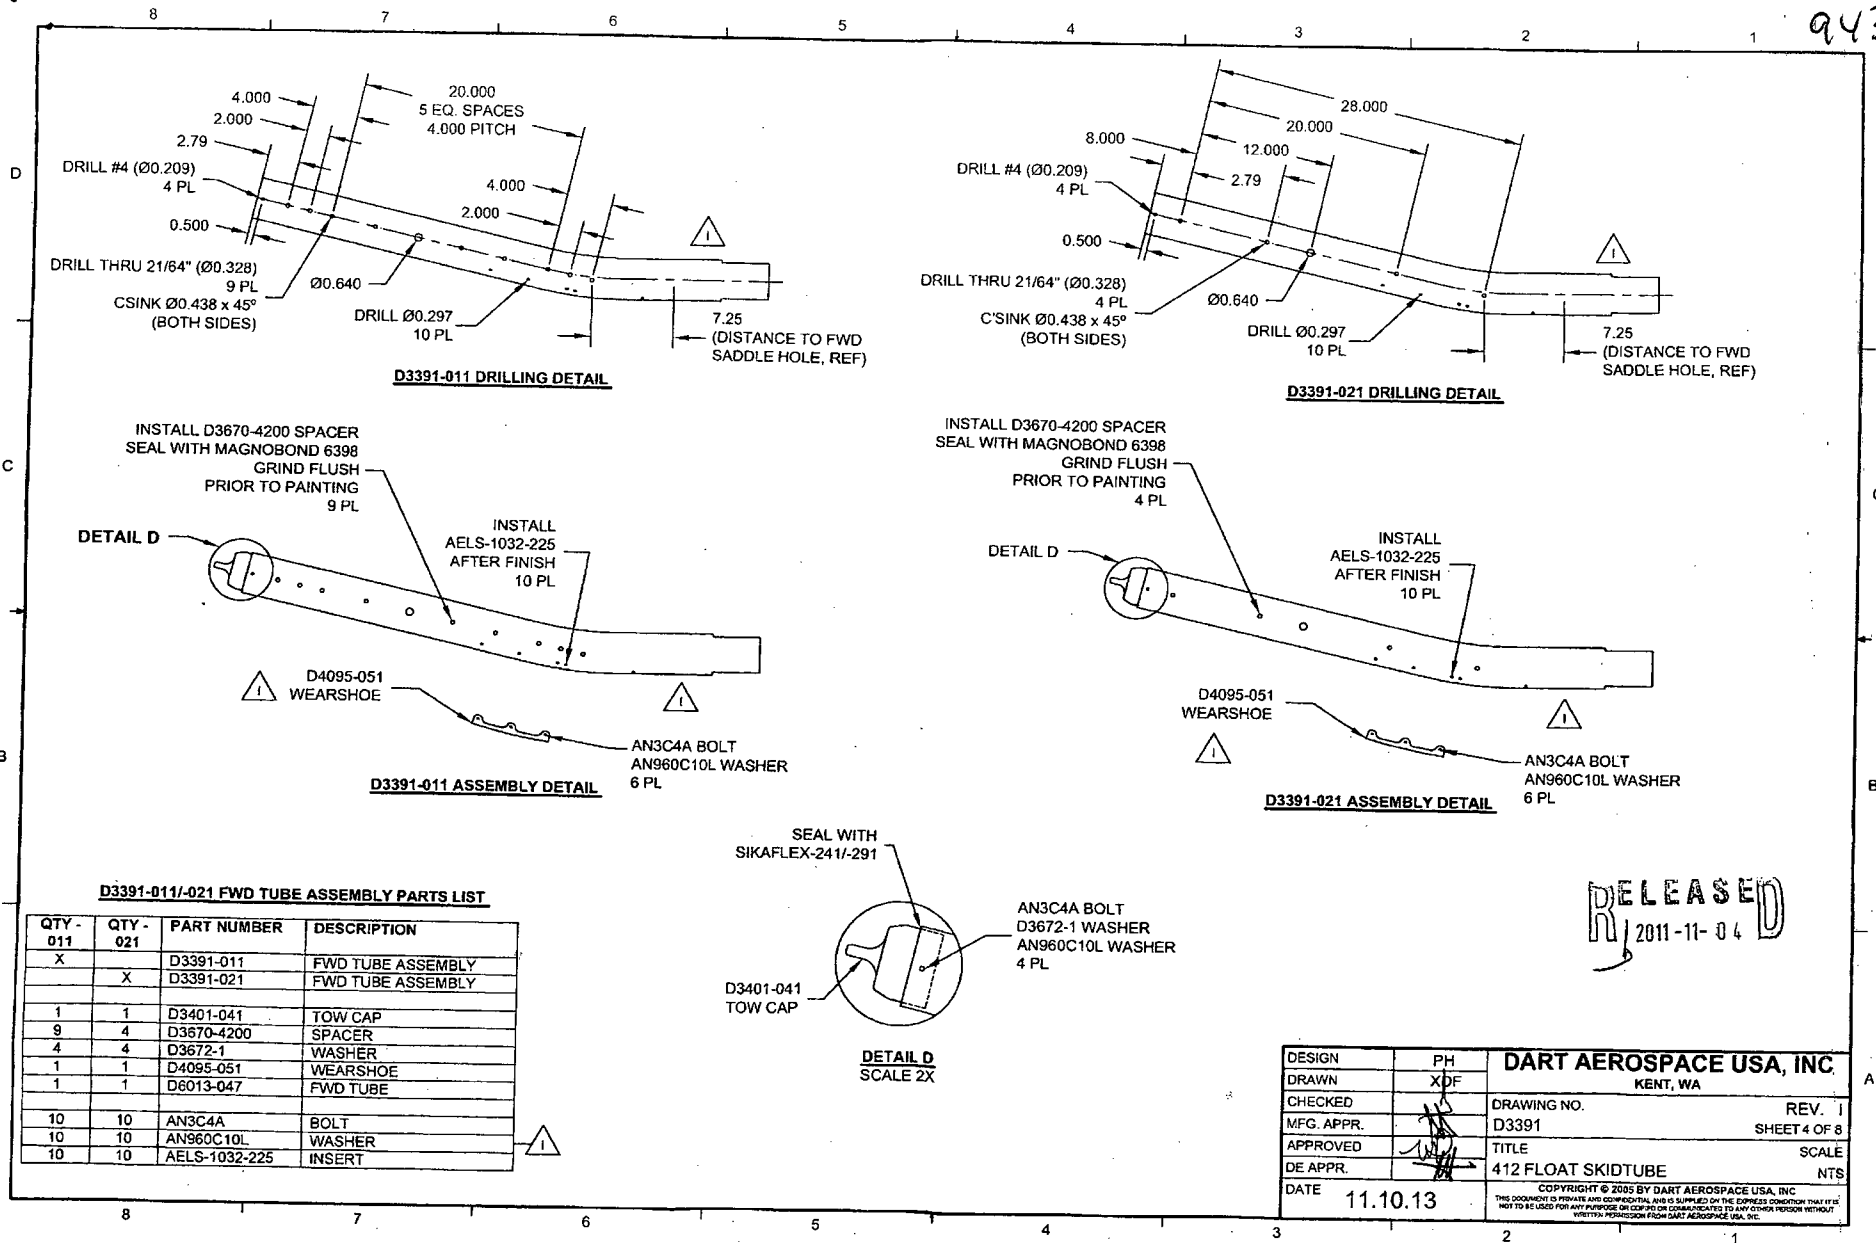


RELEASED  
2011-11-04

DESIGN	PH	<b>DART AEROSPACE USA, INC.</b>	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO.	REV. 1
MFG. APPR.		D3391	SHEET 4 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	<small>COPYRIGHT © 2005 BY DART AEROSPACE USA, INC.</small> <small>THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR FOR ANY DISSEMINATION TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	


94362

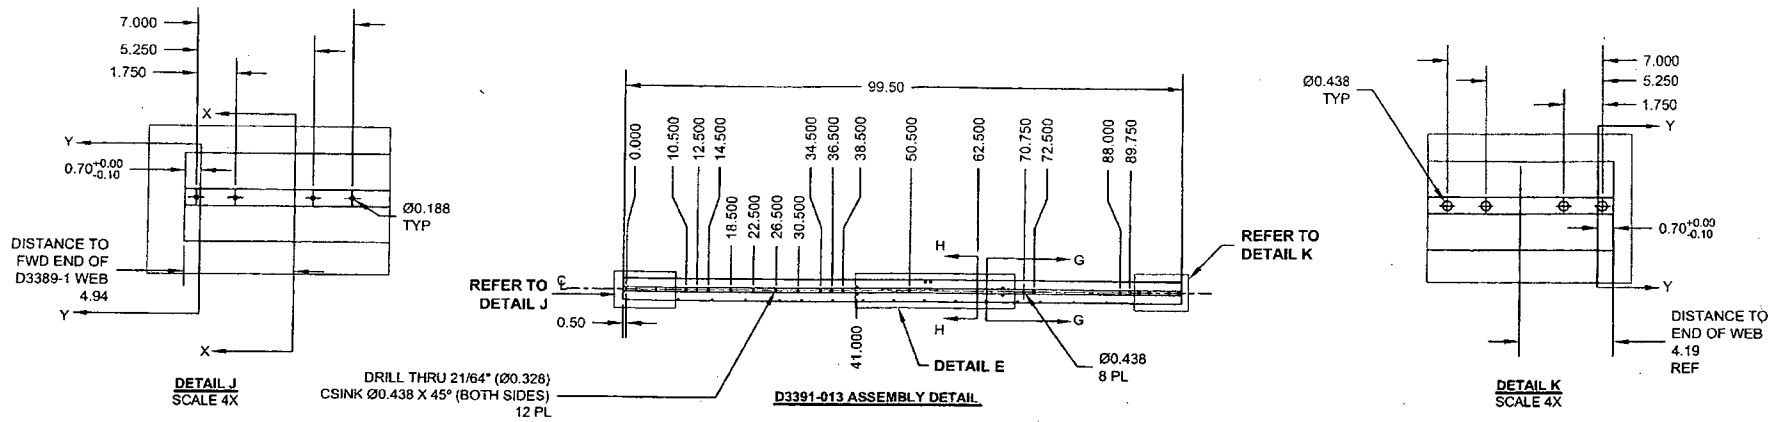


SECTION G-G  
SCALE 5X

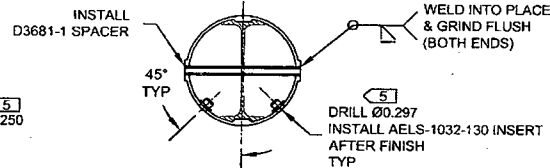

SECTION H-H  
SCALE 5X

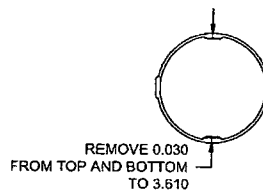

SECTION X-X  
SCALE 5X

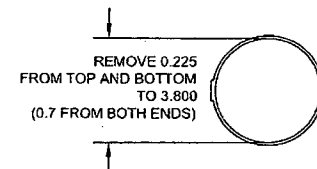


SECTION Y-Y  
SCALE 5X

**D3391-013 MID TUBE ASSEMBLY PARTS LIST**


QTY -013	PART NUMBER	DESCRIPTION
X	D3391-013	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
4	D3672-1	WASHER
4	D3672-3	WASHER
12	D3681-1	SPACER
24	AELS-1032-130	INSERT
4	ALS4-428-165	INSERT
4	AN960C10L	WASHER
4	AN960C416L	WASHER
4	MS27039C1-09	SCREW
4	MS27039C4-08	SCREW

**D3391-013 MID TUBE ASSEMBLY**


- 1) MATERIAL: MAKE FROM D2500-1-100 EXTRUSION
- 2) INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/291 PER QSI 015
- 3) WELDING: PER DART QSI 004

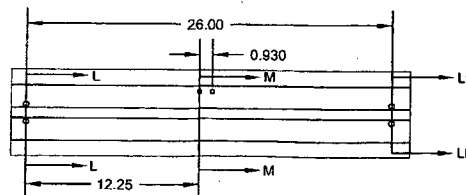


DETAIL E  
SCALE NONE

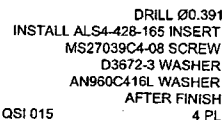

SECTION L-L  
SCALE 5X

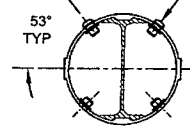

SECTION M-M  
SCALE 5X

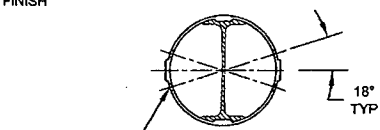


SECTION L-L-L  
SCALE 5X


RELEASED  
2011-11-04

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO.	REV. I
MFG. APPR.		D3391	SHEET 5 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR FOR ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	


94362

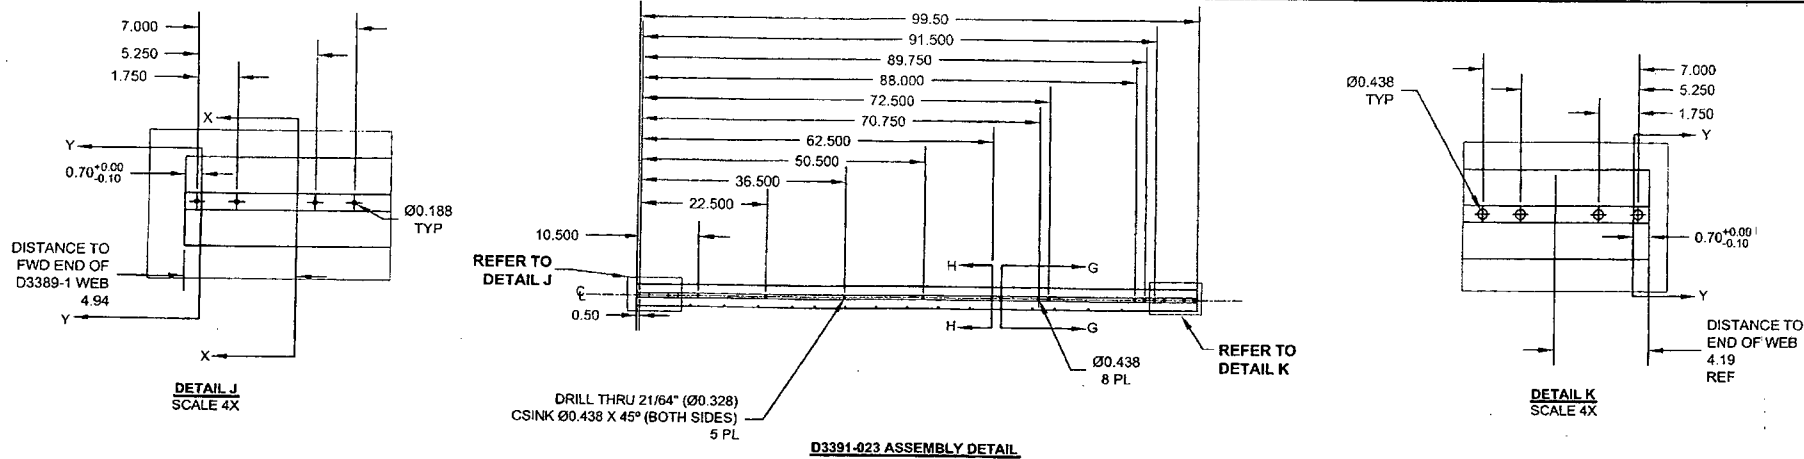


SECTION G-G  
SCALE 5X

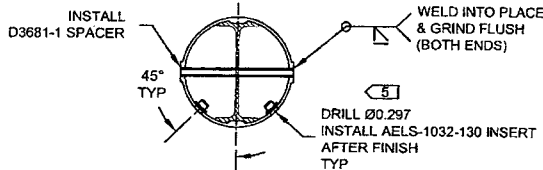

SECTION H-H  
SCALE 5X

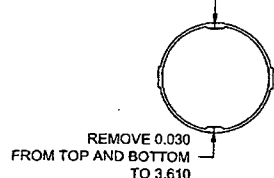

SECTION X-X  
SCALE 5X

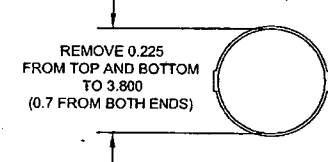

SECTION Y-Y  
SCALE 5X

**D3391-023 MID TUBE ASSEMBLY PARTS LIST**

QTY - 023	PART NUMBER	DESCRIPTION
X	D3391-023	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
5	D3681-1	SPACER
20	AELS-1032-130	INSERT


**D3391-023 MID TUBE ASSEMBLY**

- 1) MATERIAL: MAKE FROM D2500-1-100 EXTRUSION
- 2) INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/-291 PER QSI 015
- 3) WELDING: PER DART QSI 004

RELEASED  
2011-11-04



DESIGN	PH	<b>DART AEROSPACE USA, INC</b>	
DRAWN	XOF	KENT, WA	
CHECKED		DRAWING NO.	REV. I
MFG. APPR.		D3391	SHEET 6 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

94362

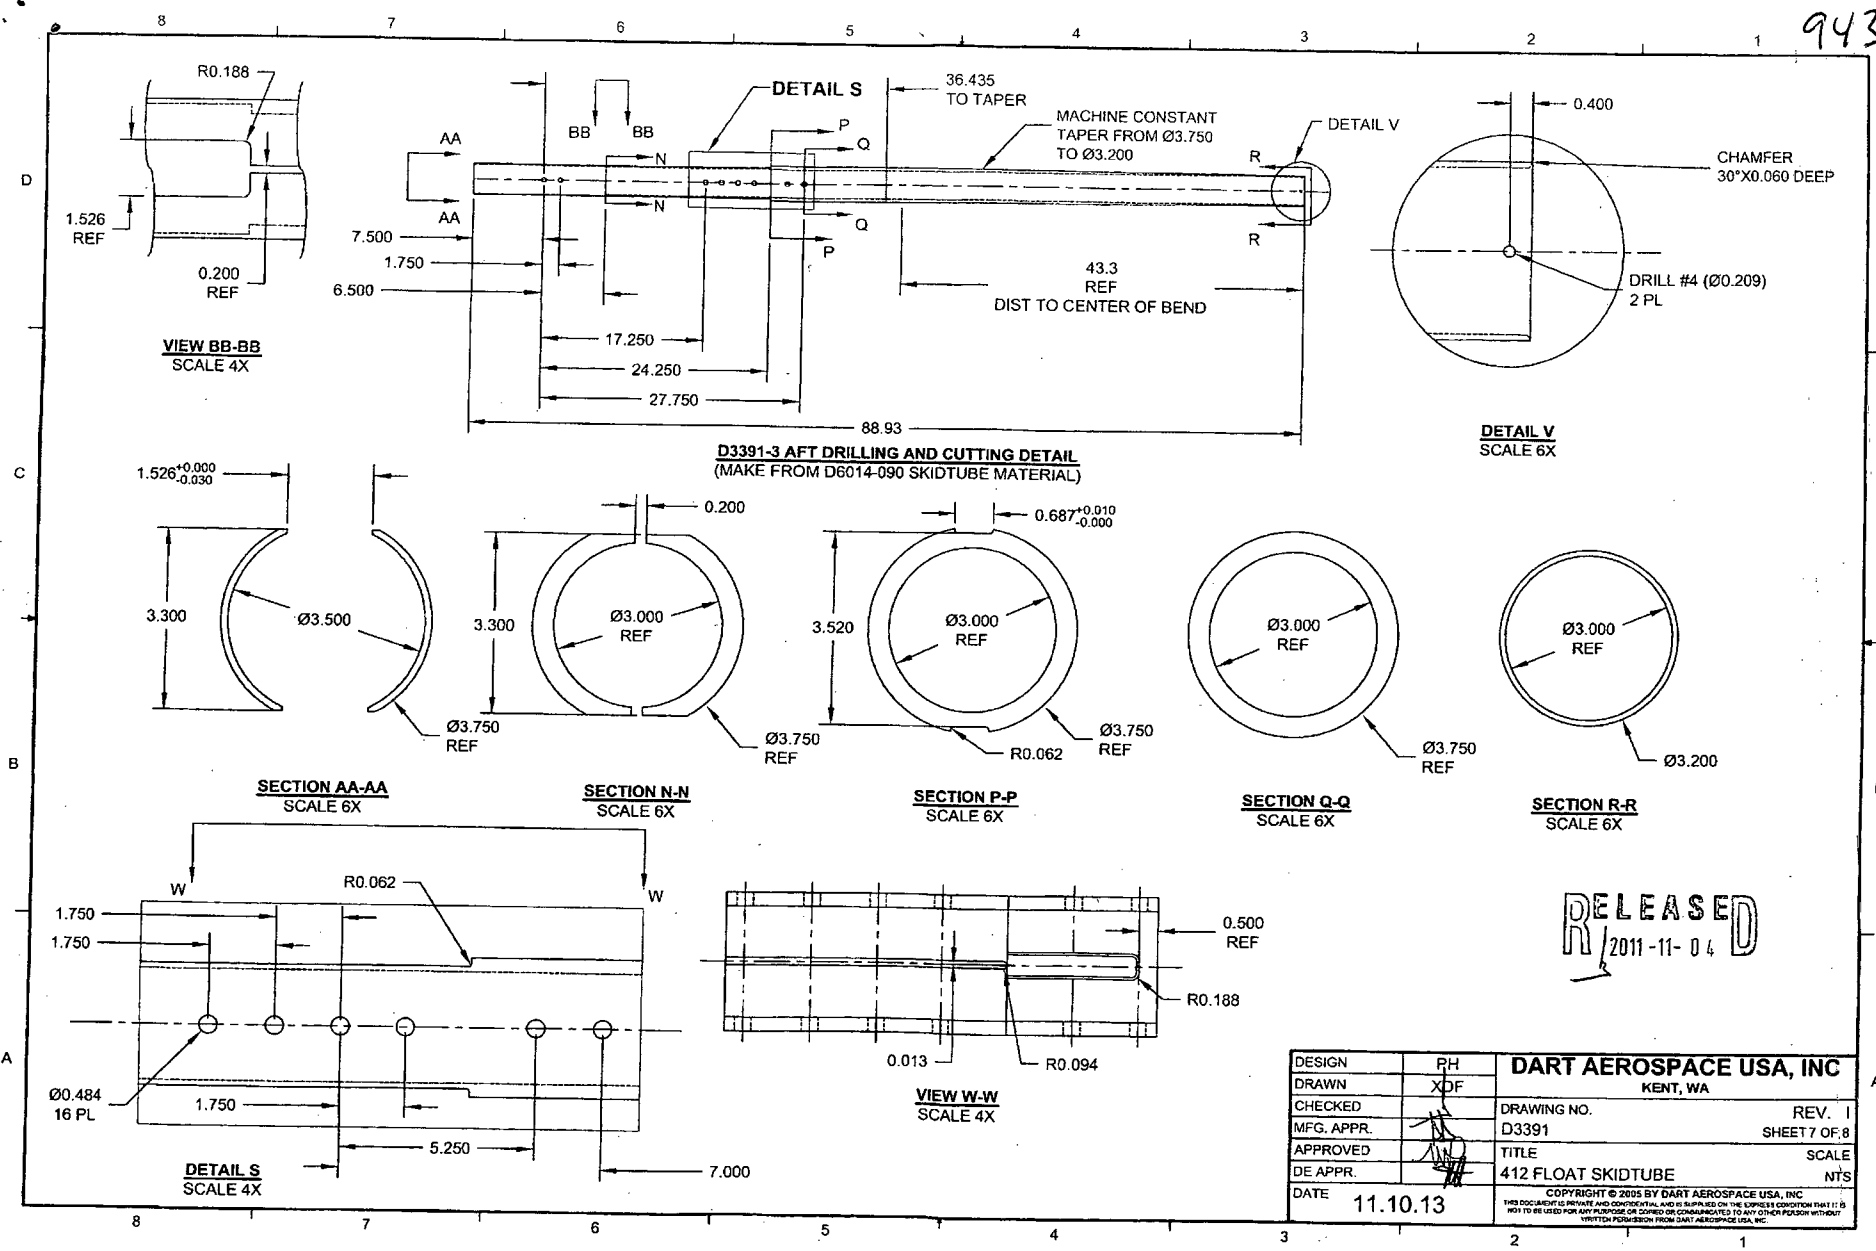




DESIGN	RH	<b>DART AEROSPACE USA, INC</b>
DRAWN	XDF	KENT, WA
CHECKED		DRAWING NO. D3391
MFG. APPR.		REV. 1 SHEET 7 OF 8
APPROVED		TITLE 412 FLOAT SKIDTUBE
DE APPR.		SCALE NTS
DATE	11.10.13	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC

94362

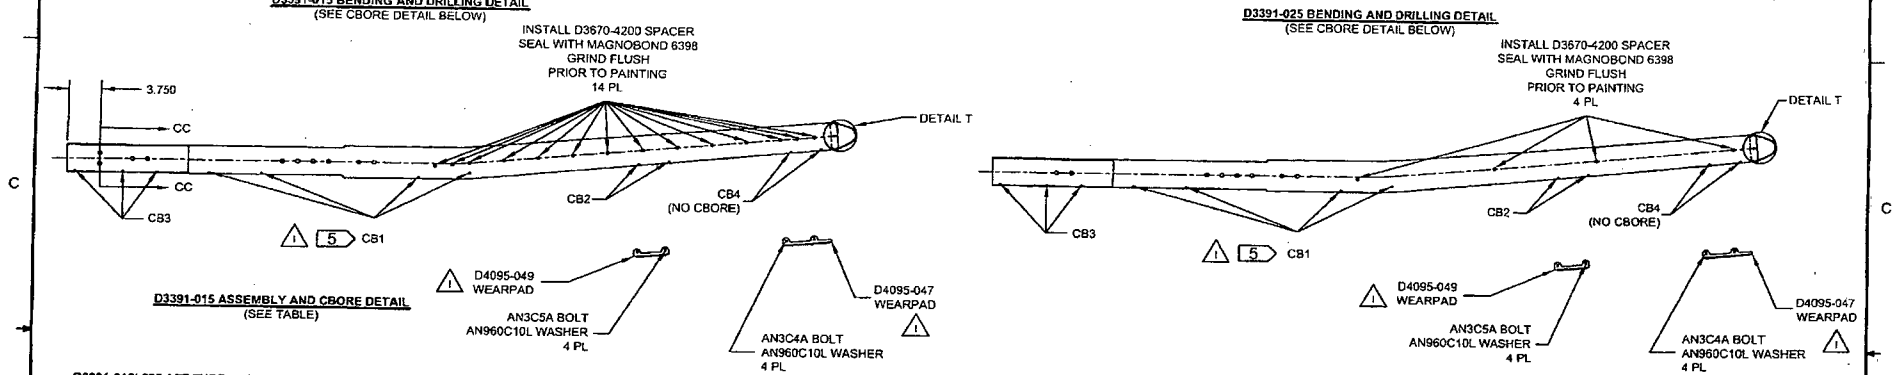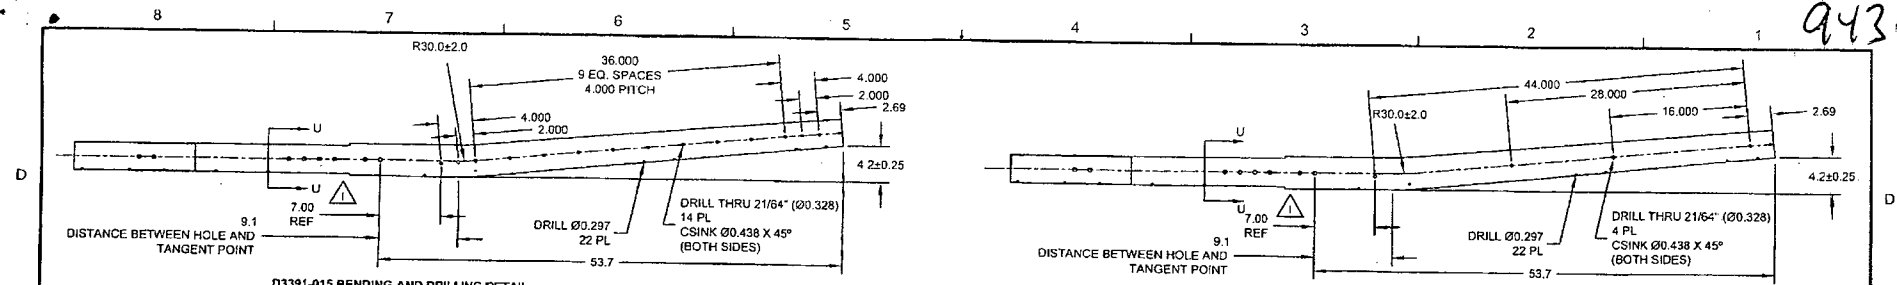

**D3391-015/-025 AFT TUBE ASSEMBLY PARTS LIST**

QTY - 015	QTY - 025	PART NUMBER	DESCRIPTION
X	X	D3391-015	AFT TUBE ASSEMBLY
		D3391-025	AFT TUBE ASSEMBLY
1	1	D2646	AFT CAP
14	4	D3670-4200	SPACER
2	2	D3672-1	WASHER
1	1	D4095-049	WEARPAD
1	1	D4095-047	WEARPAD
1	1	D6014-090	AFT TUBE
14	14	AELS-1032-130	INSERT
8	8	AELS-1032-225	INSERT
4	4	ALS4-428-165	INSERT
6	6	AN3C4A	BOLT
4	4	AN3C5A	BOLT
10	10	AN960C10L	WASHER

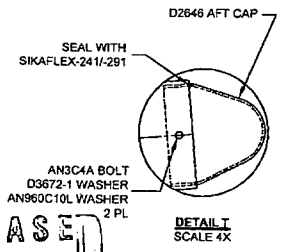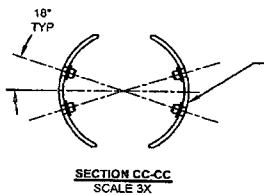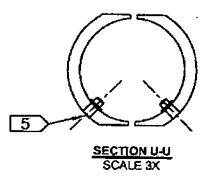


RELEASED  
2011-11-04

CBORE HOLES MARKED CB1-CB4 AS FOLLOWS AND INSTALL AELS-1032-XXX AFTER FINISH AS NOTED

HOLES MARKED	QTY D3391-015	QTY D3391-025	CBORE	P/N
CB1	8	8	Ø0.430 X 0.170	AELS-1032-225
CB2	4	4	Ø0.430 X 0.170	AELS-1032-130
CB3	6	6	Ø0.430 X 0.040	AELS-1032-130
CB4	4	4	NONE	AELS-1032-130

DESIGN	PH	<b>DART AEROSPACE USA, INC</b>	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO.	REV. 1
MFG. APPR.		D3391	SHEET 8 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

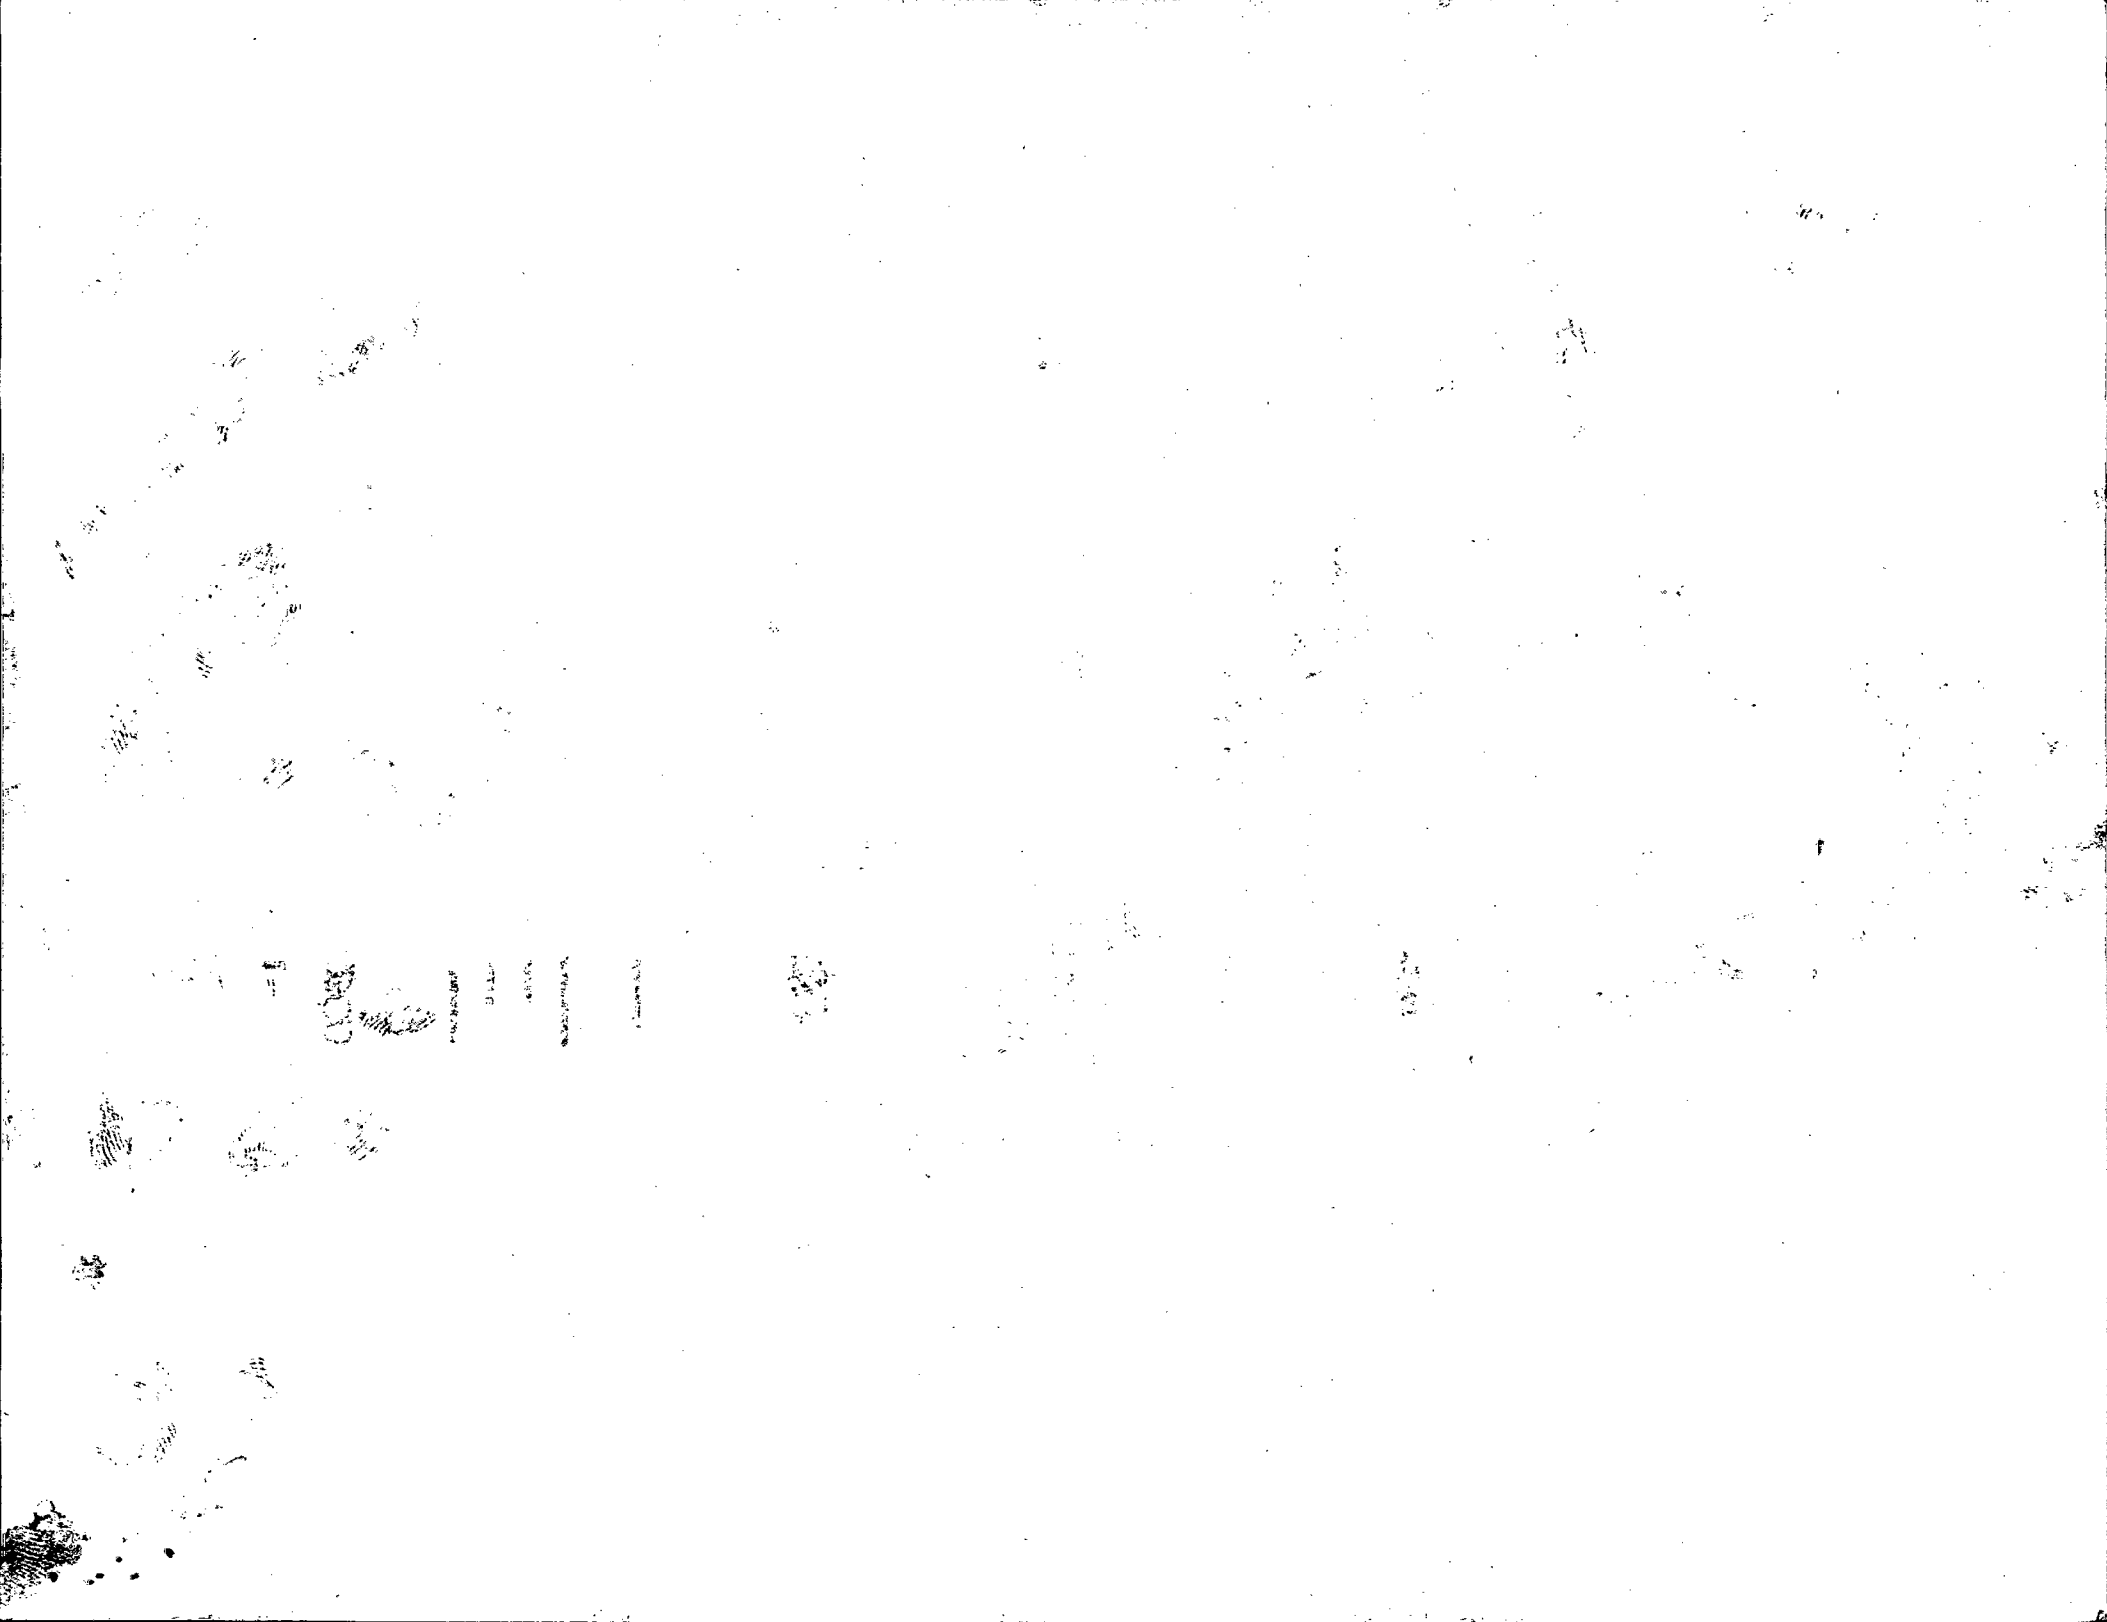

NO. 32

AWS D17.1.2001  
QUALIFICATION TEST RECORD

Name: Barclay Elliott  
Job #: 94362  
Part #: B03391-023  
Description: Mid tube  
Welding Process: Tig[☒] Mig[ ]  
Base material: Aluminium  
Current: AC[☒] DC[ ]

TEST REQUIREMENTS AND RESULTS

Visual:	pass[ <input checked="" type="checkbox"/> ]	fail[ ]
Incomplete Penetration:	pass[ <input checked="" type="checkbox"/> ]	fail[ ]
Incomplete Fusion:	pass[ <input checked="" type="checkbox"/> ]	fail[ ]
Cracks:	pass[ <input checked="" type="checkbox"/> ]	fail[ ]
Overlap (cold lap)	pass[ <input checked="" type="checkbox"/> ]	fail[ ]
Undercut:	pass[ <input checked="" type="checkbox"/> ]	fail[ ]
Pin holes:	pass[ <input checked="" type="checkbox"/> ]	fail[ ]
Porosity (surface):	pass[ <input checked="" type="checkbox"/> ]	fail[ ]
Coloration:	pass[ <input checked="" type="checkbox"/> ]	fail[ ]
Burn through:	pass[ <input checked="" type="checkbox"/> ]	fail[ ]

Qualifier DAS 09 Date of Test Coupon 13-01-29

Welder Barclay Elliott Date of Test Coupon 13-01-29

The above named individual is qualified in accordance with AWS D17.1.2001 to weld